Profile settings

Profile on Compact discs

Article number	Tube diam. Selected (mm)	Chr.size mm in Auto OFF mode	See instruction
PO-02000¤ / POZ02000¤	2.5	2.0	**A**
PO-03000¤ / POZ03000¤	2.5	2.0	**A**
PO-04000¤ / POZ04000¤	3.2	3.0	**A**
PO-05000¤ / POZ05000¤	3.6	3.0	**A**
PO-06000¤ / POZ06000¤	3.6	3.0	**A**
PO-06Q10SN¤	3.6	3.0	**A**
PO-07000¤ / POZ07000¤	5.5	3.0	**A**
PO-068TW¤ / PO-068Q¤	6.5	3.0	**A / and B**

PP-Profile on Compact discs

Article number	TAPE diam. Selected (mm)	Cassette guide	See instruction
PP-04600¤	5	MK9-CAS46	**C**
PP-06300¤	5	MK9-CAS63	**C**
PP-09000¤ / PPA-09000¤	9	MK9-CAS90	**C**
PP-10000¤	9	-	**A**
PP-11000¤	9	-	**A**

Heat Shrink tubing

Article number	Tube diam. Selected (mm)	Chr.size mm in Auto OFF mode	See instruction
PHZ20032¤	3.2	3.0	
PHZ20048¤	4.2	4.0	
PHZ20064¤	5.5	4.0	

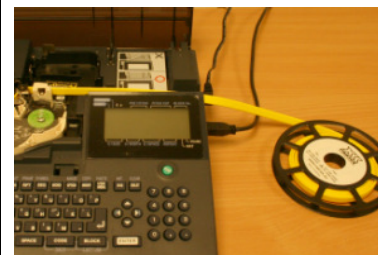## Read these chapters in the LM-390 manual

3-1   INSTALLING OR REPLACING THE INK RIBBON
3-2   LOADING THE TUBES AND THE INK RIBBON CASE
3-3   LOADING THE TAPE CASSETTE AND THE INK RIBBON CASE
6-13   OPTION
6-13-5 POSITION OF PRINTING LINE
6-13-6 CUTTING POSITION
8-1-2   INSTALLING THE PRINTER DRIVER
9.   TROUBLE SHOOTING

Hints:

- To get a good printing result the profiles temperature should be at least **+25°C** .
- Don't forget to make an height adjustment of the text.

A.

Alternative 1: Feed the profile trough the printer so that it prints on the side that faces the reel core. (See the example below)

Alternative 2: Feed the profile trough the printer so that it prints on the side that **doesn't** face the reel core. (See the example below)

B.

PO-068Q10
Straighten the profile towards you as the picture shows. Then close the lid.

C.

Remove the transparent lid from the cassette. Feed the profile trough the cassette so that it looks like the picture below. Very carefully put back the transparent lid

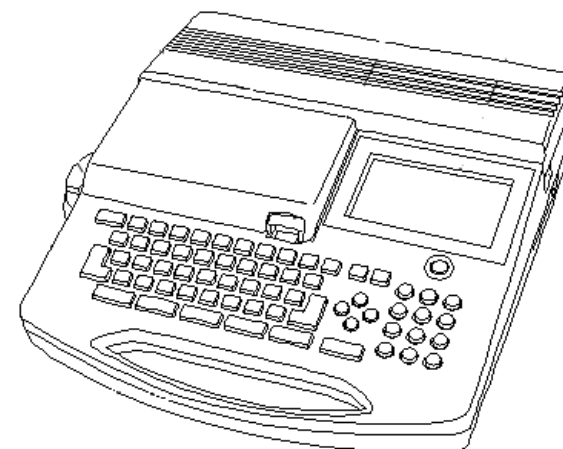Mount the guide cassette into the ProMark as a normal tape cassette.

Important

1. Read first the LM-390 manual so that you understand how the printer works. You will find it in the lid in the carrying case

2. New products can be added to this system, so you will always find the latest version of this document on our homepage: **www.partex.nu**   Sheet **download**.

3. If you want to have your printer repaired. Contact the retailer you bought it from and they will send it to be repaired. It's very important that you explain what is wrong with the printer so that it can be repaired quicker. Too much information is better then none at all.

4. Place the printer in an "office" environment. Too much dust can scratch the printing head. Too much humidity will affect the printing result.

5. Keep the profile in a dry and clean place. A clean and dry profile will give you a better printing result

	INFO
Printing method	Thermal transfer method (300 dpi)
Printing speed	35mm/s (Standard) 20mm/s (Low temperature mode)
Maximum printing length	Tube: 20m, Tape: 5m
Maximum number of characters to input	5,000 characters
Character size	2, 3, 4, 6mm height
Usable tube	Ø 2.5 to 6.5
Usable tape	Width 5, 9, 12mm
Tube cutting method	Auto half cut, manual full cut
Operating environment	+10°C to +35°C
Recommended profile temperature	+25°C
Pitch Length	Tube: 10.0～60.0mm Tape: 4.0～60.0mm

QUICK START
FOR MK9-USB

ENGLISH

XXX® PARTEX
MARKING SYSTEMS